



Accessories for A/AE/AL/AF contactors

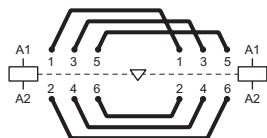

BEM circuit diagram



BES110 connection diagram



BED...

Connection kits for reversing

Mounting on 3 pole contactors	Catalog number	List price
A/AE/AL9 – A/AE/AL16	BEM16-30	\$ 23
A/AE/AL26	BEM26-30	30
A/AE/AL30, A/AE/AL40	BEM40-30	45
A/AE/AF50 – A/AE/AF75	BEM75-30	165
A/AE/AF95, A/AE/AF110	BEM110-30	180
A/AF145 – A/AF185	BEM185-30	260
A/AF210 – A/AF300	BEMA300-30	470
AF400 – AF460	BEM460-30	850
AF580 – AF750	BEM750-30	1200

Application

Connections between the main poles of **two 3 pole contactors** mounted side by side so that they operate as reversing contactors.

Description

The connection kits for reversing contactors are made up of three reversing connections and three phase to phase connections.

- BEM16-30 — Insulated, solid, rigid copper wires
- BEM26 and 40-30 — Insulated, stranded, rigid copper wires
- BEM75 and 110-30 — Insulated, solid copper bars

Connection kits for phase to phase

Mounting on 3 pole contactors	Catalog number	List price
A/AE/AF50, A/AE/AF75	BES75-30	\$ 75
A/AE/AF95, A/AE/AF110	BES110-30	90
A/AF145 – A/AF185	BES185-30	130
A/AF210 – A/AF300	BESA300-30	200
AF400 – AF460	BES460-30	425
AF580 – AF750	BES750-30	650

The connection kit for phase to phase contactors is made up of three phase to phase bus bars.

Connection kits for wye-delta starters

Mounting on contactors		Catalog number	List price
Line and delta contactor	Wye contactor		
A30	A26	BED40U	\$ 53
A40	A26		
A50	A30	BED50U	165
A63	A40		
A75	A50	BED75U	180
A95	A75	BED95U	195
A110	A95	BED110U	225
A145	A110	BED145U	250
A185	A145	BED185U	290
A210	A185	BED210U	375
A260/A300	A210	BED300U	500
AF400/AF460	A260/A300	BED400U	850
AF460	AF400	BED460U	900
AF580	AF400/AF460	BED580U	1250
AF750	AF580	BED750U	1450

Application

Connections between the main poles of a wye-delta starter.

Description

- The connection kits for wye-delta starters are made up of:
- Three line contactor/wye contactor connections — line side.
 - Three wye contactor/delta contactor connections — load side.
 - The shorting connection for the "S" contactor.

BED40U – Insulated, stranded, rigid copper wires.

BED50U thru BED750U — Insulated, solid copper bars.

The above connection sets allow a mechanical interlock unit to be mounted between the wye and delta contactors if required.